



Test Report

Date Issued : 2022-02-11

Report No. : 11055C01031-2-5-02

Version : A

Service Item : 日照計累積照度比對英文測試報告

Brand Name : -----

Model(Item No./Style) : -----

Serial No. : -----

Client

Company Name : 日灝能源科技股份有限公司

Address : 新北市板橋區溪福里金門街 369 巷 11 號 7 樓

Result of Service Item, performed by ITRI Laboratory, is specified on the next/ following page(s).

This report, including a signature page and content, is a total of 10 pages. The validity of this report no longer exists if signature page and content are separated.



Vice President and General Director
Green Energy and Environment
Research Laboratories

Department Manager



Commission Information:

Sample name : Pyranometer

Brand name 、 Model no. 、 Serial no. : Refer to table 1

Duration of test : August 10 to December 31, 2021

Laboratory Information:

Lab. name: Photovoltaics System Testing Laboratory

Address of Lab.: Rm. 415, BF., No. 360, Gaofa 2nd Rd., Guiren Dist., Tainan City 711,
Taiwan (R.O.C.)

Tel: +886-6-3636861

Fax: +886-6-3032029

宋洪義

Approval Signatory

宋洪義

Testing Lab. Head




I. Test Results and Descriptions:

1. Information of pyranometer


Table 1				
Item	Brand name	Model no.	Serial no.	Provider
Table A	Hukseflux	SR30-D1	6586	ITRI-GEL-R300- Photovoltaics System Testing Laboratory
Table B	Deltaohm	PYRA03AC	21013200	日灝能源
Table C	Hukseflux	SR05-D2A2	9379	日灝能源

2. Documentation:

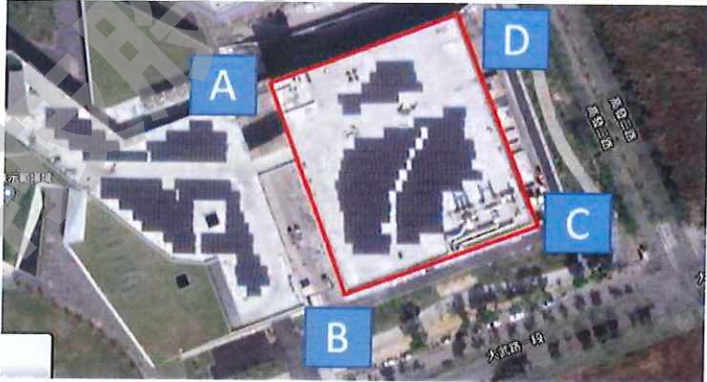Table 2	
Customer information	日灝能源科技股份有限公司
Test site address	Roof of Building C, No. 360, Gaofa 2nd Rd., Guiren Dist., Tainan City 郵遞區號, Taiwan (R.O.C.) 台南市歸仁區高發二路 360 號 C 棟屋頂
Site information	
Latitude · Longitude	A(22°55'15.4"N 120°17'29.6"E) B(22°55'13.0"N 120°17'30.6"E) C(22°55'13.8"N 120°17'32.8"E) D(22°55'16.1"N 120°17'31.8"E)
Data acquisition timing and reporting	Sampling 3 seconds
	Recording 1 minute
	Reporting 2021/08/10~2021/12/31
Angle of pyranometer	Global horizontal irradiance



3. Measured parameters:

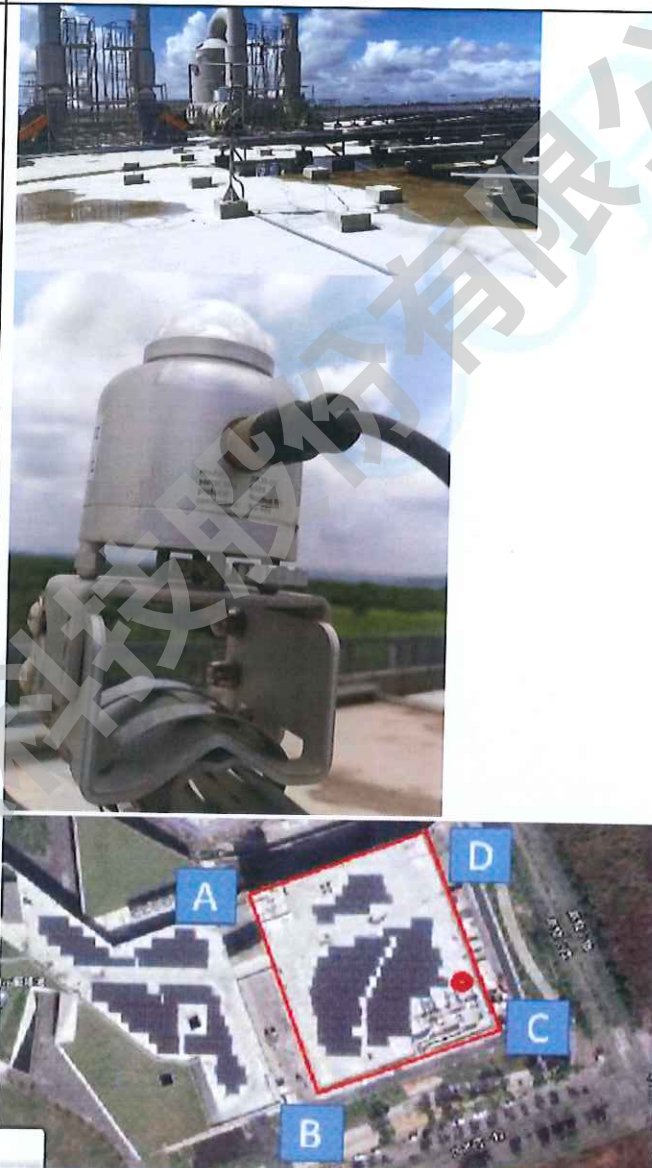
Table A		
Measured parameters	Global horizontal irradiance	
Number of sensor	1 pcs	
Manufacturer	Hukseflux	
Mode/Serial No.	SR30-D1/6586	
Sensor locations		
	Pyranometer at the red circle	
Sensor maintenance	Recalibration	(1) Once per year (2) Report No.: <u>N/A</u>
Sensor type	Classified	



日灝能源科技股份有限公司所有，請勿複製

☒ Thermopile pyranometers	☒ Class A	☒ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☐ Class C	Any: _____
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____

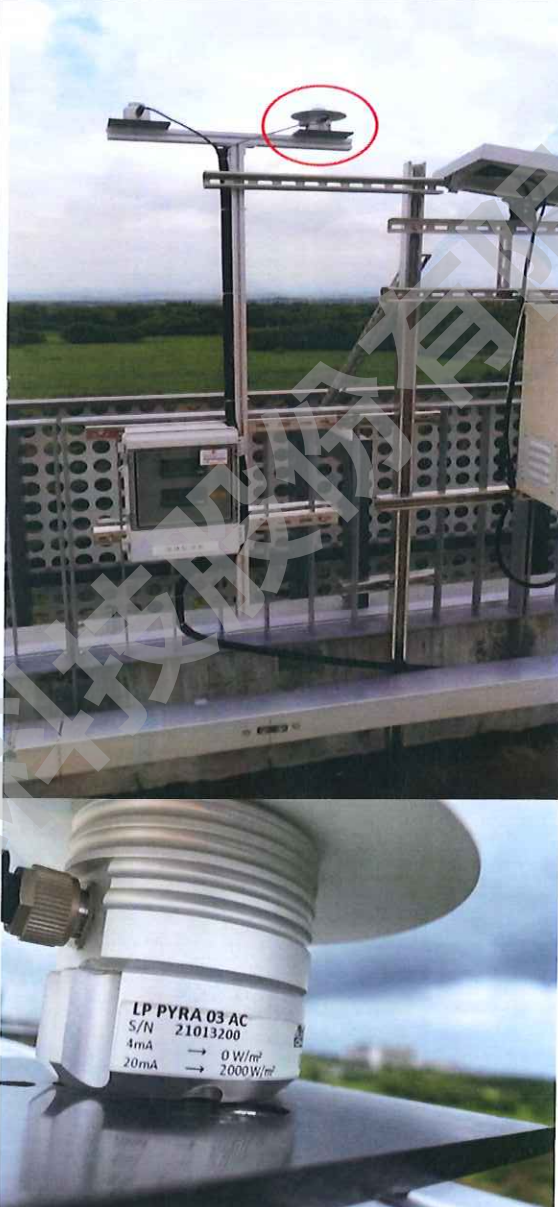

Table B	
Measured parameters	Global horizontal irradiance
Number of sensor	1 pcs
Manufacturer	Deltaohm
Mode/Serial No.	PYRA03AC/21013200
Sensor locations	






		
	Pyranometer at the red circle	
Sensor maintenance	Recalibration	N/A
Sensor type	Classified	
■ Thermopile pyranometers	☐ Class A	☐ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	■ Class C	Any: <u>Second class pyranometer according to ISO 9060.</u>
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____



Table C	
Measured parameters	Global horizontal irradiance
Number of sensor	1 pcs
Manufacturer	Hukseflux
Mode/Serial No.	SR05-D2A2/9379
Sensor locations	



		
	Pyranometer at the red circle	
Sensor maintenance	Recalibration	N/A
Sensor type	Classified	
☒ Thermopile pyranometers	☐ Class A	☐ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☒ Class C	Any: <u>Second class pyranometer according to ISO 9060.</u>
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____

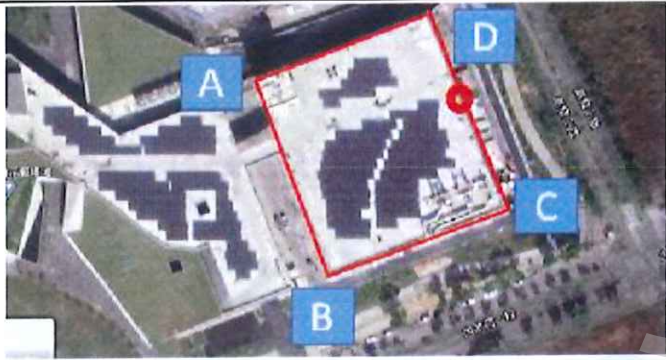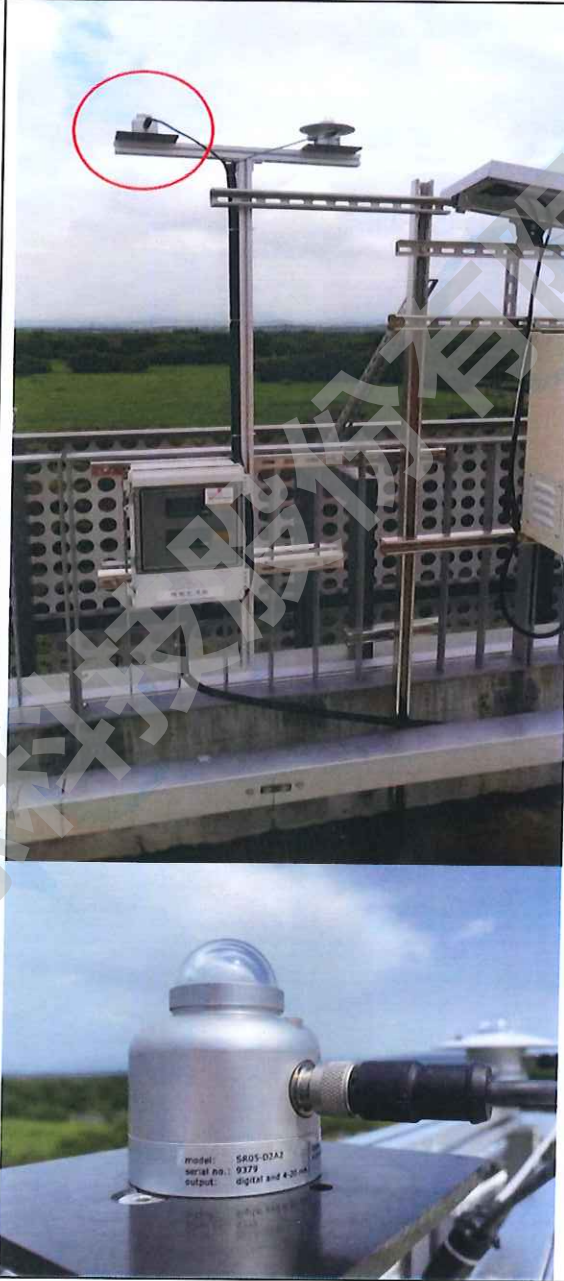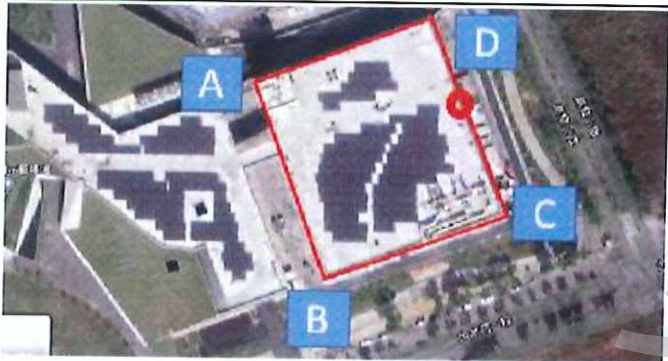

4. Test result:

Date(summation the irradiance in the reporting period)	Summing the irradiance (kWh/m ²)		
	Model:SR30-D1	Model:LPPYRA03AC	Model:SR05-D2A2
	SN:6586	SN:21013200	SN:9379
2021/08/10~2021/08/28	70.19	66.85	70.13
2021/09/03~2021/09/30	145.22	138.58	145.12
2021/11/04~2021/11/30	103.73	100.46	103.68
2021/12/01~2021/12/31	113.36	108.57	111.10
2021/08/10~2021/12/31	432.50	414.46	430.03
Deviation (Benchmark:SR30-D1)	N/A	3.1%	1.6%
Note: (1) The power system of the test site will be repaired during the period from October 01, 2021 to October 31, 2021. (2) 2021/08/10~2021/08/28 Testing report NO. : 11055C01031-2-1-02-RPT-1 (3) 2021/09/03~2021/09/30 Testing report NO.: 11055C01031-2-2-02-RPT-1 (4) 2021/11/04~2021/11/30 Testing report NO.: 11055C01031-2-3-02-RPT-1 (5) 2021/12/01~2021/12/31 Testing report NO.: 11055C01031-2-4-02-RPT-1			

II. Descriptions:

1. Date and Location of Test

The test was performed at the site address in table2, ITRI during the period from August 10, 2021 to December 31, 2021.

2. Test Methods : According to the IEC 61724-1:2017.

III. References:

1. IEC 61724-1 : 2017, first edition, Photovoltaic system performance –Part 1: Monitoring.



Test Report

Date Issued : 2022-02-11

Report No. : 11055C01031-2-6-02

Version : A

Service Item : 日照計累積照度比對英文測試報告

Brand Name :-----

Model(Item No./Style) :-----

Serial No. :-----

Client

Company Name : 日灝能源科技股份有限公司

Address : 新北市板橋區溪福里金門街 369 巷 11 號 7 樓

Result of Service Item, performed by ITRI Laboratory, is specified on the next/ following page(s).

This report, including a signature page and content, is a total of 11 pages. The validity of this report no longer exists if signature page and content are separated.



Chao Yang Huang

Vice President and General Director
Green Energy and Environment
Research Laboratories

Department Manager

Commission Information:

Sample name : Pyranometer

Brand name 、 Model no. 、 Serial no. : Refer to table 1

Duration of test : January 01 to January 31, 2022

Laboratory Information:

Lab. name: Photovoltaics System Testing Laboratory

Address of Lab.: Rm. 415, BF., No. 360, Gaofa 2nd Rd., Guiren Dist., Tainan City 711,
Taiwan (R.O.C.)

Tel: +886-6-3636861

Fax: +886-6-3032029

Approval Signatory

宋洪義

Testing Lab. Head

宋洪義




I. Test Results and Descriptions:

1. Information of pyranometer

Table 1				
Item	Brand name	Model no.	Serial no.	Provider
Table A	Hukseflux	SR30-D1	6586	ITRI-GEL-R300- Photovoltaics System Testing Laboratory
Table B	Deltaohm	PYRA03AC	21013200	日灝能源
Table C	Hukseflux	SR05-D2A2	9379	日灝能源

2. Documentation:

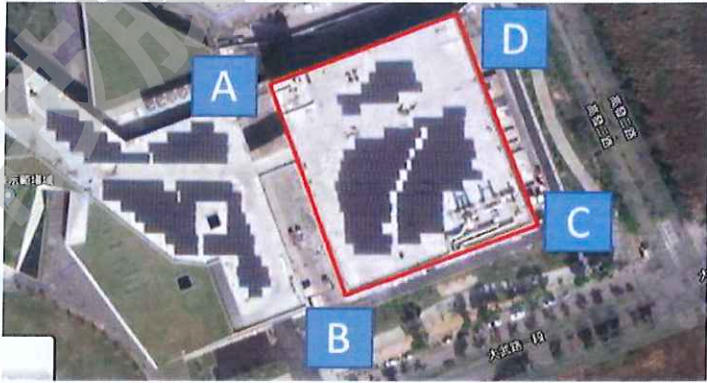Table 2	
Customer information	日灝能源科技股份有限公司
Test site address	Roof of Building C, No. 360, Gaofa 2nd Rd., Guiren Dist., Tainan City 郵遞區號, Taiwan (R.O.C.) 台南市歸仁區高發二路 360 號 C 棟屋頂
Site information	
Latitude , Longitude	A(22°55'15.4"N 120°17'29.6"E) B(22°55'13.0"N 120°17'30.6"E) C(22°55'13.8"N 120°17'32.8"E) D(22°55'16.1"N 120°17'31.8"E)
Data acquisition timing and reporting	Sampling 3 seconds
	Recording 1 minute
	Reporting 31 days (2022/01/01~2022/01/31)
Angle of pyranometer	Global horizontal irradiance



3. Measured parameters:

Table A		
Measured parameters	Global horizontal irradiance	
Number of sensor	1 pcs	
Manufacturer	Hukseflux	
Mode/Serial No.	SR30-D1/6586	
Sensor locations		
Sensor maintenance	Recalibration	(1) Once per year (2) Report No.: <u>N/A</u>
Sensor type	Classified	



☒ Thermopile pyranometers	☒ Class A	☒ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☐ Class C	Any: _____
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $\text{W}\cdot\text{m}^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $\text{W}\cdot\text{m}^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____





Table B	
Measured parameters	Global horizontal irradiance
Number of sensor	1 pcs
Manufacturer	Deltaohm
Mode/Serial No.	PYRA03AC/21013200
Sensor locations	






		
Pyranometer at the red circle		
Sensor maintenance	Recalibration	N/A
Sensor type	Classified	
☒ Thermopile pyranometers	☐ Class A	☐ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☒ Class C	Any: <u>Second class pyranometer according to ISO 9060.</u>
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____



Table C	
Measured parameters	Global horizontal irradiance
Number of sensor	1 pcs
Manufacturer	Hukseflux
Model/Serial No.	SR05-D2A2/9379
Sensor locations	



		
Pyranometer at the red circle		
Sensor maintenance	Recalibration	N/A
Sensor type	Classified	
☒ Thermopile pyranometers	☐ Class A	☐ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☒ Class C	Any: <u>Second class pyranometer according to ISO 9060.</u>
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____

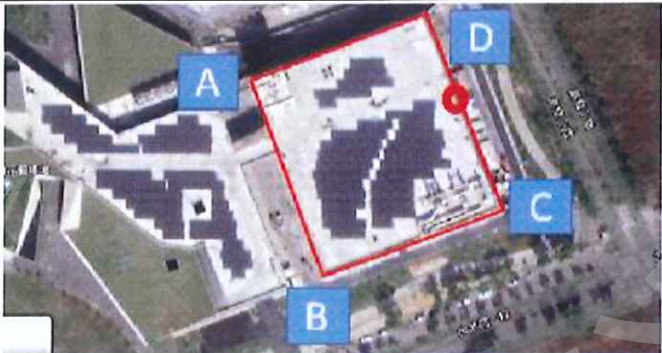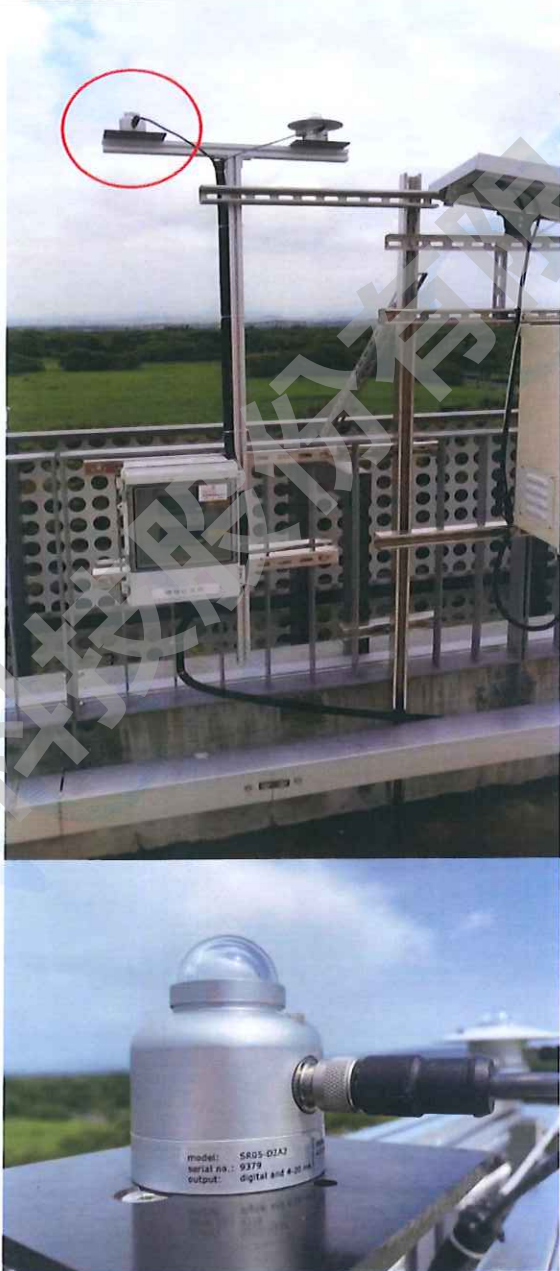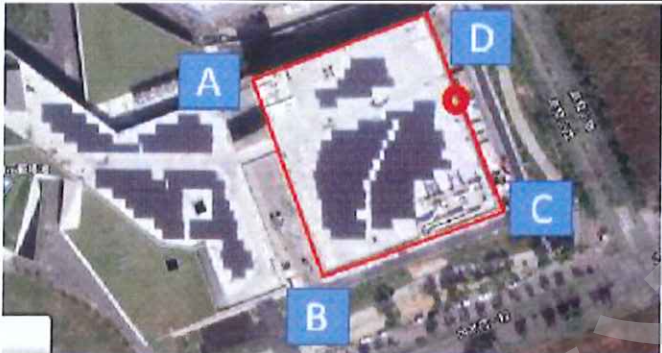

4. Test result:

Date	Duration ^{Note 1}	Module no./SN		
		SR30-D1	LPPYRA03AC	SR05-D2A2
		6586	21013200	9379
2022/01/01 ^{Note 2}	06:59:21~17:08:12	4.83	4.68	4.76
2022/01/02	06:57:00~17:08:00	4.69	4.56	4.64
2022/01/03	06:56:15~17:09:06	4.66	4.49	4.58
2022/01/04	07:04:06~17:01:00	3.77	3.65	3.71
2022/01/05	07:18:30~16:51:45	2.86	2.76	2.81
2022/01/06	07:21:27~16:49:36	3.06	2.95	2.99
2022/01/07	07:08:12~17:02:45	4.29	4.18	4.23
2022/01/08	07:04:21~17:17:48	4.40	4.26	4.35
2022/01/09	07:00:48~17:19:12	4.59	4.42	4.53
2022/01/10	06:56:33~17:21:15	4.50	4.35	4.45
2022/01/11	07:16:12~18:06:27	3.11	3.21	3.06
2022/01/12	07:09:21~17:23:15	1.98	1.92	1.96
2022/01/13	06:53:09~17:11:48	4.52	4.39	4.48
2022/01/14	06:54:27~17:16:03	4.50	4.33	4.43
2022/01/15	06:57:06~17:21:00	4.61	4.44	4.58
2022/01/16	06:56:57~17:09:51	4.51	4.37	4.47
2022/01/17	06:54:51~16:50:06	3.92	3.79	3.86
2022/01/18	07:15:06~17:20:51	1.79	1.72	1.74
2022/01/19	07:07:42~17:23:24	3.82	3.73	3.81
2022/01/20	07:01:33~17:18:03	3.97	3.81	3.89
2022/01/21	06:56:57~17:20:03	3.45	3.32	3.40
2022/01/22	07:55:39~16:36:15	1.71	1.65	1.68
2022/01/23	07:00:42~16:57:15	3.23	3.11	3.21
2022/01/24	07:32:54~17:17:45	2.56	2.50	2.55
2022/01/25	06:58:39~17:27:27	4.33	4.20	4.33
2022/01/26	06:56:24~17:27:27	4.62	4.45	4.61
2022/01/27	07:25:12~17:24:33	4.35	4.22	4.35
2022/01/28	07:00:24~16:13:51	1.87	1.79	1.81
2022/01/29	07:48:36~17:24:03	1.26	1.22	1.22
2022/01/30	07:06:03~17:03:15	1.88	1.78	1.83
2022/01/31	07:06:27~17:08:39	4.28	4.20	4.25
2022/01/01~2022/01/31 Summing the irradiance		111.93	108.42	110.59
Deviation(Benchmark:SR30-D1)		N/A	3.14%	1.20%

Note 1: According to process data for irradiance and PV-generated power should be restricted to the daylight hours of each day (sunrise to sunset, irradiance $\geq 20 \text{ W/m}^2$) to avoid extraneous night-time data values that introduce errors in analyses, unless such errors have been



demonstrated to be negligible.

Note 2: Start to tset.

II. Descriptions:


1. Date and Location of Test

The test was performed at the site address in table2, ITRI during the period from January 01, 2022 to January 31, 2022.

2. Test Methods : According to the IEC 61724-1:2017.

III. References:

1. IEC 61724-1 : 2017, first edition, Photovoltaic system performance –Part 1: Monitoring.





Test Report

Date Issued : 2022-03-14

Report No. : 11055C01031-2-7-02

Version : A

Service Item : 日照計累積照度比對英文測試報告

Brand Name : -----

Model(Item No./Style) : -----

Serial No. : -----

Client

Company Name : 日灝能源科技股份有限公司

Address : 新北市板橋區溪福里金門街 369 巷 11 號 7 樓

Result of Service Item, performed by ITRI Laboratory, is specified on the next/ following page(s).

This report, including a signature page and content, is a total of 11 pages. The validity of this report no longer exists if signature page and content are separated.



General Director
Green Energy & Environment Lab

Department Manager

Commission Information:

Sample name : Pyranometer

Brand name 、 Model no. 、 Serial no. : Refer to table 1

Duration of test : February 01 to February 28, 2022

Laboratory Information:

Lab. name: Photovoltaics System Testing Laboratory

Address of Lab.: Rm. 415, BF., No. 360, Gaofa 2nd Rd., Guiren Dist., Tainan City 711,
Taiwan (R.O.C.)

Tel: +886-6-3636861

Fax: +886-6-3032029

宋洪義

Approval Signatory

宋洪義

Testing Lab. Head




I. Test Results and Descriptions:

1. Information of pyranometer

Table 1				
Item	Brand name	Model no.	Serial no.	Provider
Table A	Hukseflux	SR30-D1	6586	ITRI-GEL-R300- Photovoltaics System Testing Laboratory
Table B	Deltaohm	PYRA03AC	21013200	日灝能源
Table C	Hukseflux	SR05-D2A2	9379	日灝能源

2. Documentation:

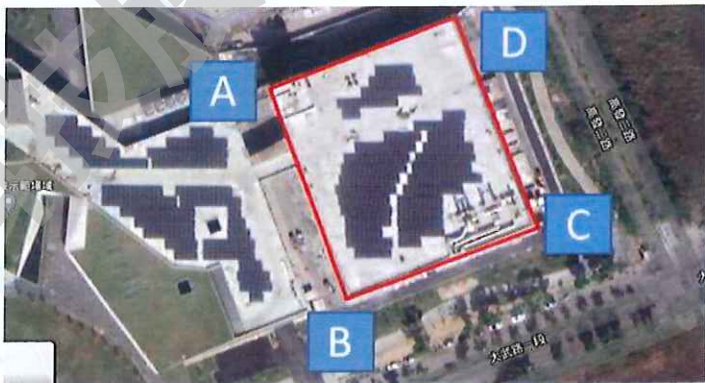Table 2	
Customer information	日灝能源科技股份有限公司
Test site address	Roof of Building C, No. 360, Gaofa 2nd Rd., Guiren Dist., Tainan City 郵遞區號, Taiwan (R.O.C.) 台南市歸仁區高發二路 360 號 C 棟屋頂
Site information	
Latitude · Longitude	A(22°55'15.4"N 120°17'29.6"E) B(22°55'13.0"N 120°17'30.6"E) C(22°55'13.8"N 120°17'32.8"E) D(22°55'16.1"N 120°17'31.8"E)
Data acquisition timing and reporting	Sampling 3 seconds
	Recording 1 minute
	Reporting 28 days (2022/02/01~2022/02/28)
Angle of pyranometer	Global horizontal irradiance



3. Measured parameters:

Table A		
Measured parameters	Global horizontal irradiance	
Number of sensor	1 pcs	
Manufacturer	Hukseflux	
Mode/Serial No.	SR30-D1/6586	
Sensor locations		
Sensor maintenance	Recalibration	(1) Once per year (2) Report No.: 11107C00444-1-1-03
Sensor type	Classified	



Table B	
Measured parameters	Global horizontal irradiance
Number of sensor	1 pcs
Manufacturer	Deltaohm
Mode/Serial No.	PYRA03AC/21013200
Sensor locations	






	 Pyranometer at the red circle	
Sensor maintenance	Recalibration	N/A
Sensor type	Classified	
☒ Thermopile pyranometers	☐ Class A	☐ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☒ Class C	Any: <u>Second class pyranometer according to ISO 9060.</u>
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____



Table C	
Measured parameters	Global horizontal irradiance
Number of sensor	1 pcs
Manufacturer	Hukseflux
Model/Serial No.	SR05-D2A2/9379
Sensor locations	



		
	Pyranometer at the red circle	
Sensor maintenance	Recalibration	N/A
Sensor type	Classified	
☒ Thermopile pyranometers	☐ Class A	☐ Secondary standard per ISO 9060 ☐ High quality per WMO Guide No. 8 (Uncertainty $\leq 3\%$ for hourly totals)
	☐ Class B	☐ First class per ISO 9060 ☐ Good quality per WMO Guide No. 8 (Uncertainty $\leq 8\%$ for hourly totals)
	☒ Class C	Any: <u>Second class pyranometer according to ISO 9060.</u>
☐ PV reference cell ☐ PV reference module	☐ Class A	Uncertainty $\leq 3\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class B	Uncertainty $\leq 8\%$ from (100 ~1500) $W \cdot m^2$
	☐ Class C	Any: _____
☐ Photodiode sensors	☐ Class A	Not applicable: _____
	☐ Class B	Not applicable: _____
	☐ Class C	Any: _____

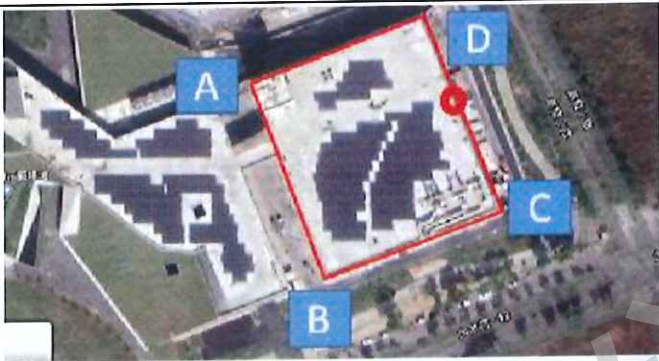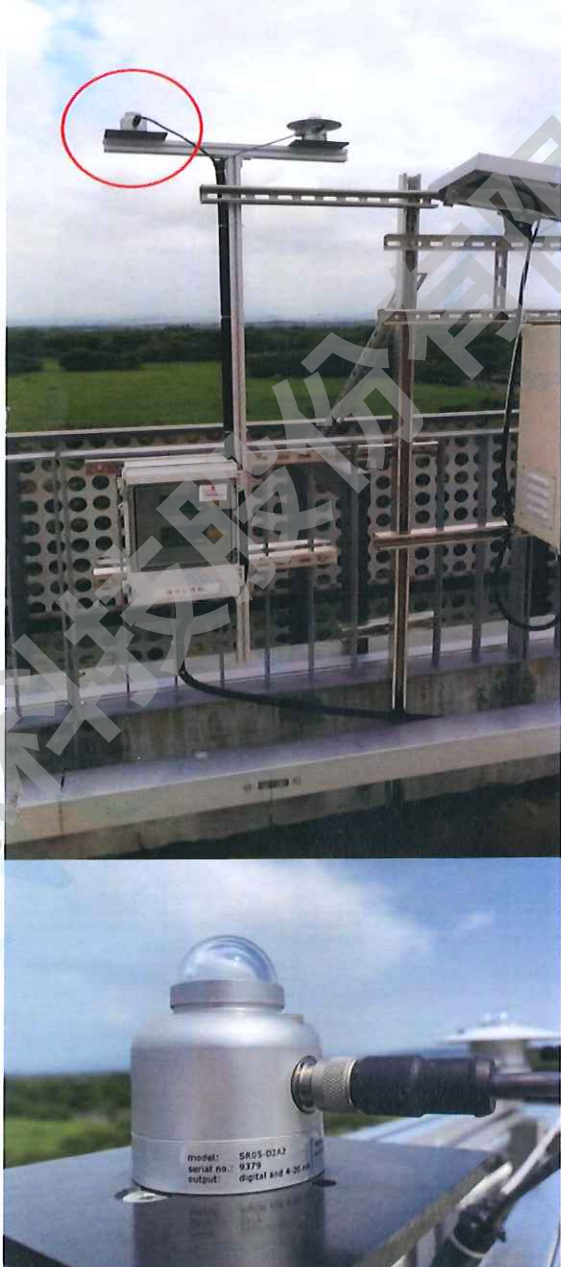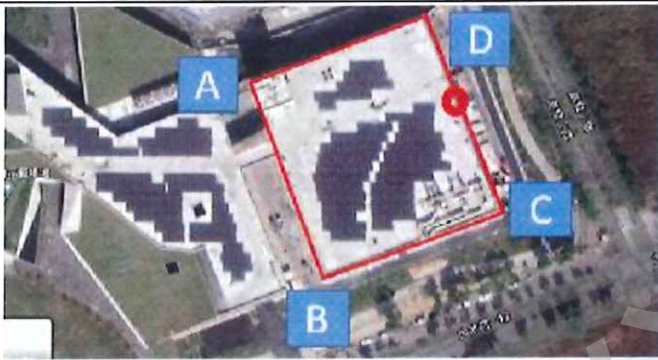

4. Test result:

Date	Duration ^{Note 1}	Module no./SN		
		SR30-D1	LPPYRA03AC	SR05-D2A2
		6586	21013200	9379
2022/02/01 ^{Note 2}	07:00:48~17:30:03	3.94	3.83	3.92
2022/02/02	07:00:15~17:30:06	4.92	4.78	4.90
2022/02/03	07:03:21~17:25:42	3.28	3.19	3.25
2022/02/04	07:04:12~17:36:45	4.90	4.80	4.92
2022/02/05	06:57:24~17:30:21	4.71	4.60	4.67
2022/02/06	06:47:33~17:37:00	4.68	5.14	5.30
2022/02/07	07:13:24~17:26:27	3.20	3.10	3.17
2022/02/08	06:59:24~17:33:37	4.70	4.57	4.69
2022/02/09	07:20:00~17:37:42	5.10	4.97	5.13
2022/02/10	06:58:51~17:31:03	4.92	4.81	4.89
2022/02/11	07:24:36~17:45:15	4.42	4.31	4.32
2022/02/12	07:00:21~17:39:54	5.11	5.03	5.12
2022/02/13	07:19:36~17:28:48	3.98	3.80	3.70
2022/02/14	07:18:42~17:23:03	2.59	2.50	2.56
2022/02/15	07:13:18~17:26:33	2.69	2.60	2.66
2022/02/16	06:49:39~17:38:12	5.18	5.55	5.21
2022/02/17	07:32:33~17:28:51	1.93	1.86	1.86
2022/02/18	07:35:18~17:42:57	4.30	4.16	4.28
2022/02/19	06:58:45~16:52:03	3.46	3.37	3.39
2022/02/20	07:56:09~16:02:00	0.55	0.54	0.52
2022/02/21	07:41:00~17:19:51	0.81	0.77	0.75
2022/02/22	07:02:03~16:52:00	2.13	2.06	2.04
2022/02/23	07:40:42~17:09:57	0.98	0.95	0.93
2022/02/24	07:11:12~17:23:48	3.22	3.13	3.14
2022/02/25	06:39:39~17:45:48	5.87	5.69	5.59
2022/02/26	06:48:36~17:42:18	6.01	5.85	5.85
2022/02/27	06:47:18~17:48:48	5.73	5.58	5.61
2022/02/28	06:35:51~17:49:21	6.26	6.02	6.15
2022/02/01~2022/02/28 Summing the irradiance		109.57	107.57	108.51
Deviation(Benchmark:SR30-D1)		N/A	1.83%	0.97%

Note 1: According to process data for irradiance and PV-generated power should be restricted to the daylight hours of each day (sunrise to sunset, irradiance $\geq 20 \text{ W/m}^2$) to avoid extraneous night-time data values that introduce errors in analyses, unless such errors have been demonstrated to be negligible.

Note 2: Start to tset.



II. Descriptions:

1. Date and Location of Test

The test was performed at the site address in table2, ITRI during the period from February 01, 2022 to February 28, 2022.

2. Test Methods : According to the IEC 61724-1:2017.

III. References:

1. IEC 61724-1 : 2017, first edition, Photovoltaic system performance –Part 1: Monitoring.

